Scale Calibration for L-EQ 5/10 & 10/20

- 1. Turn on the scale and during the initial countdown/dashes press the TARE KG ZERO keys in that sequence. (QUICKLY AS POSSIBLE)
- 2. After countdown sequence is complete enter the password: 100100 = to calibrate in KG 100101 = to calibrate in LB

$$\overline{zero} = 0 \& \overline{tare} = 1$$

- 3. After entering the password, press the key.
- 4. If the password is correct the display will read RZERO (zero reference); with the scale being free of any weight press the key.
- 5. Next the RLOAD (load reference) message will be displayed, place the maximum weight capacity and press the key, wait until the countdown is finished.

 (5 to 0)
- 6. Remove the weight, turn off and Power ON the scale. The scale should be calibrated and now check for accuracy.