


HOW TO CLEAN THE FOB

during scheduled Line Cleaning.

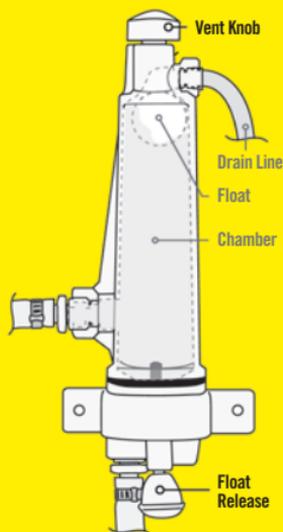


PRO-MAX-3

- 1 Disconnect Keg(s)**
and connect to cleaning system.
- 2 Push Up Float Release**
allowing the cleaning solution to circulate through the FOB in either direction.
- 3 Push Down & Hold Vent Knob**
while cleaning until the chamber is full and cleaning solution vents out the drain line, cleaning the chamber, vent and drain.
- 4 Rinse with Water**
Repeat step 3 while rinsing the system with water.
- 5 Push Down & Hold Vent Knob**
while rinsing until the chamber is full and water vents out the drain line rinsing the chamber, vent and drain.
- 6 Pull Down Float Release**

 **CLEAN**


 **RINSE**

 **RESET**

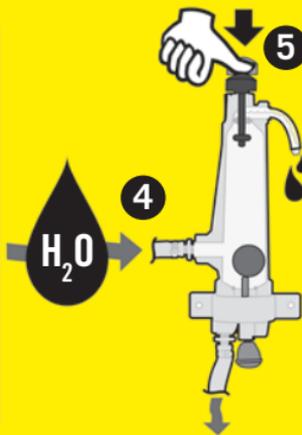

HOW TO RESET THE FOB

when replacing an empty keg.

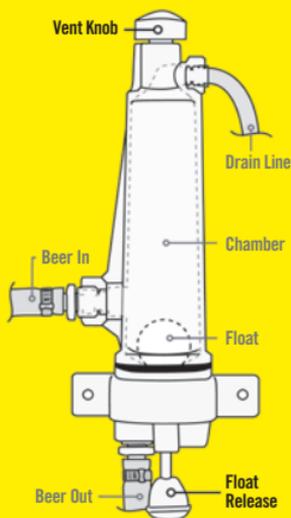

PRO-MAX-3

- 1 Disconnect Empty Keg**
and tap a fresh keg.
- 2 Push Down & Hold Vent Knob**
to refill chamber completely with beer. While venting, a small amount of beer and foam will escape through the drain line.
- 3 Push Up Float Release**
to allow the float to rise to top of chamber and allow beer to flow to the faucet.
- 4 Pull Down Float Release**
resetting the FOB to normal operation.

! The **Float Release** must be in the pull down position for proper operation.



REFILL >



RELEASE >



RESET

