



Regency Deck-Mounted Faucet with 4" Centers and 14" Swing Spout

#600FD414



Technical Data

Spout Length	14 Inches
Faucet Height	5 11/16 Inches
Cartridge Type	Ceramic
Faucet Centers	4 Inches
Features	NSF Certified NSF/ANSI 372 NSF/ANSI 61
Finish	Chrome
Flow Rate	2 GPM
Handle Type	Lever

Features

- 14" swing spout with 2 GPM aerator
- 4" adjustable centers, 1/2" NPS inlets
- Temperature rating 40 - 140 degrees Fahrenheit
- Chrome-plated brass construction
- Leak-resistant quarter-turn ceramic cartridges with check valves

Certifications



1/2" Water Connection




NSF Certified

Technical Data

Material	Brass
Mounting Style	Deck Mounted
Mounting Type	Workboard
Rough In	4 Inches
Spout Clearance	3 3/8 Inches
Spout Connection Size	1"-20 UNEF
Spout Type	Swing
Sprayer	Without Sprayer
Temperature Rating	140 Degrees F
Thread Type	NPS
Type	Faucets
Water Inlet Size	1/2 Inches

Plan View

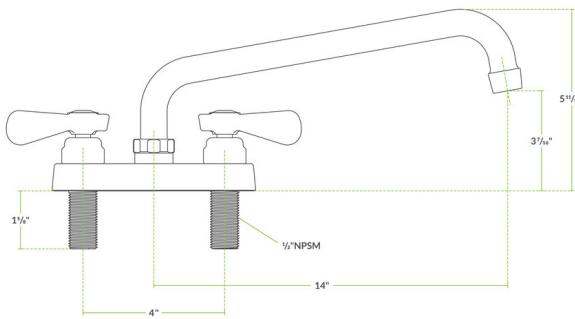

Notes & Details

This Regency deck-mounted faucet is the perfect solution when you need a dependable water fixture in your facility! Regency faucets provide the industry-leading quality you expect. With a chrome-plated brass faucet body and ceramic cartridges engineered for durability, you can install this model with confidence. This faucet features a 14" long swing spout that moves easily around the sink bowl, while a 2 GPM aerator provides a consistent flow rate and minimal splashing. It boasts a set of 4" adjustable centers, while the deck-mounted design is easy to install with 1/2" male NPS inlets.

This faucet uses ceramic cartridges, which provide a much lower fail rate than the compression cartridges widely used in the industry. In this design, 2 ceramic discs fit together to create a watertight seal when closed. This removes the need for a rubber seat washer, which is one of the most frequently replaced parts on a faucet. The sturdy lever handle design makes it easy to turn the water flow off and on.

⚠️ WARNING: This product can expose you to chemicals including lead, which are known to the State of California to cause cancer and birth defects or other reproductive harm. For more information, go to www.p65warnings.ca.gov.